

14E2115BS64

DINGS' MOTION
work order
DATE REV00

REVISION



REV.

DATE



DESCRIPTION

DRAWN BY

Sticker

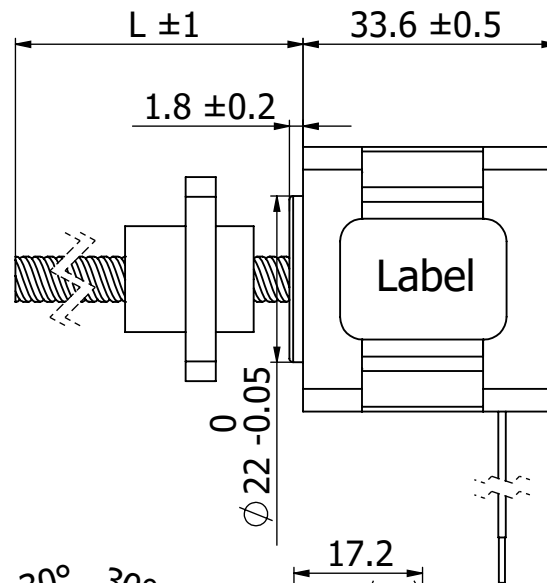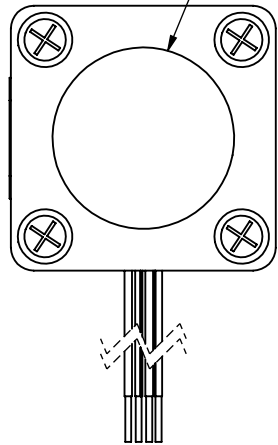

4-M3 ↓ 4Min

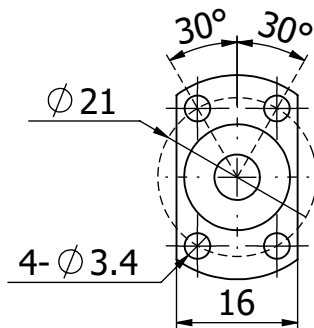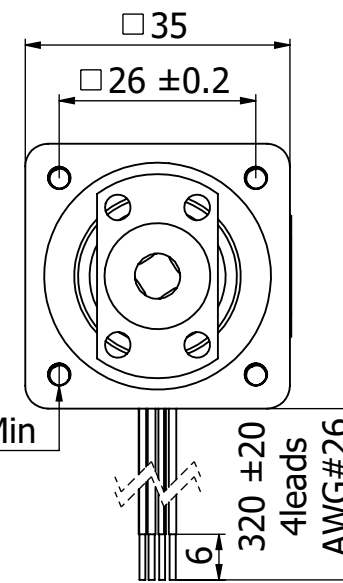


Notes,
1.To maximize output force and life of linear actuators,
radial load on lead screws should be avoided or be kept at a minimum.

Motor's phase	2
Step angle(±5%)	1.8°
Rated current/phase	1.5 A(RMS)
Resistance/phase(20°C)	1.8 Ω±10%
Inductance/phase(1V,1kHz)	1.9 mH±20%
Linear travel per step	0.03mm
Lead screw diameter	Φ 6mm
Lead screw lead	6mm
Grade	C7 (DY)
Insulation class	B
Insulation resistance	100MΩ(500VDC)
Heat rise	80°C
Motor weight	0.19 Kg

CUSTOMER

WIRING CHART

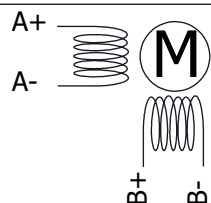

EXCITATION SEQUENCE

CW	→			
Red A+	+		-	
d/wht A-	-		+	
Grn B+		+		
n/wht B-		-		
CCW	←			

NOTICE TO PERSONS RECEIVING THIS DRAWING
THIS DRAWING IS ONLY CONDITIONALLY ISSUED, AND FOR THE SOLE PURPOSE OF INFORMING LICENSEES AND ASSOCIATE CONTRACTORS OF DINGS' MOTION, AND VENDORS THERETO AND CUSTOMERS THEREOF, RECEIPT OR POCESSION THEREOF DOES NOT CONFER TO TRANSFER ANY RIGHT IN THE SUBJECT MATTER OF THE DRAWING. THE DESIGN, CONSTRUCTION, TECHNICAL INFORMATION AND ALL OTHER SUBJECT MATTER SHOWN AND ASSOCIATE CONTRACTORS OF SAID CORPORATION AND ONLY FOR LICENSED MANUFACTURE, AND BY VENDORS MANUFACTURING FOR SAID CORPORATION AND ONLY FOR LICENSEES AND ASSOCIATECONTRACTORS.

UNLESS OTHERWISE SPECIFIED ALL DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ARE AS BELOW PER ISO2768-ck.			
LINEAR		ANGULAR	
0 ~ 3	±0.2	0 ~ 10	±15'
3 ~ 6	±0.5	10 ~ 50	±30'
6 ~ 30	±0.8	50 ~ 120	±1°
30 ~ 120	±1.5	120 ~ 400	±1.5°

DRAWN

DATE

APPRVD

DATE

MODEL

14E2115BS64

DINGS'

SIZE	A3	SHEET	1 OF 1
SCALE	1 : 1	REV	00

