
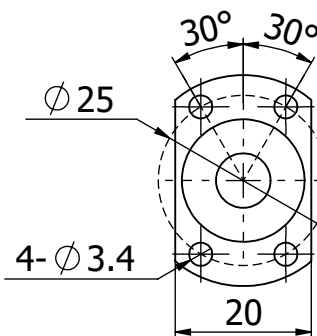
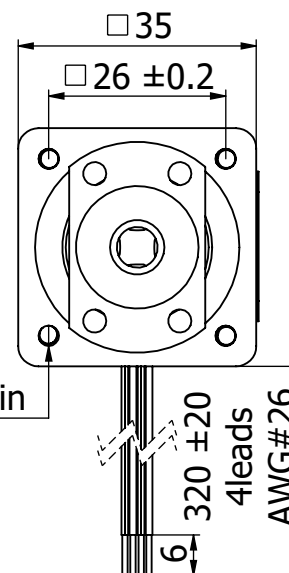
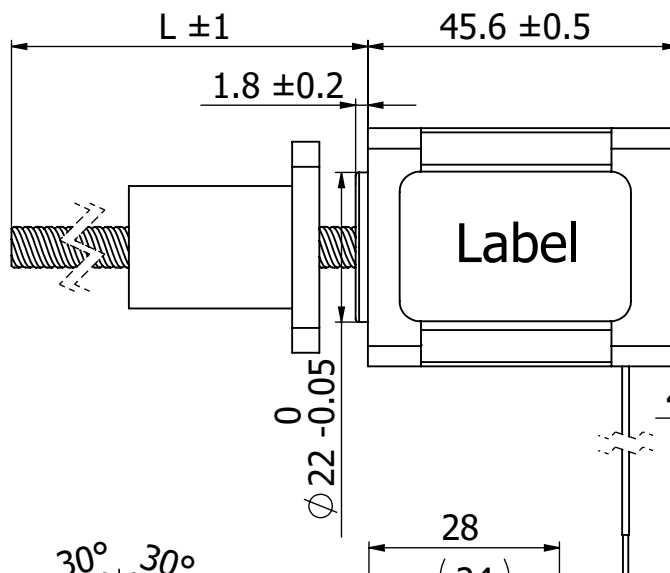


DINGS' MOTION
work order
DATE REV00

Sticker

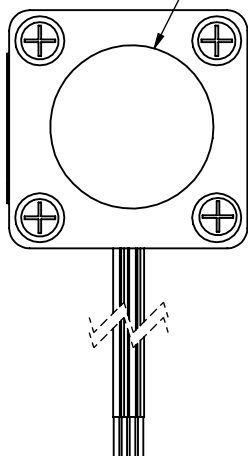


Notes,

1. To maximize output force and life of linear actuators, radial load on lead screws should be avoided or be kept at a minimum.

Motor's phase	2
Step angle(±5%)	1.8°
Rated current/phase	1.0 A(RMS)
Resistance/phase(20°C)	6 Ω±10%
Inductance/phase(1V,1kHz)	7.2 mH±20%
Linear travel per step	0.025mm
Lead screw diameter	Ø 8mm
Lead screw lead	5mm
Grade	C7 (DY)
Insulation class	B
Insulation resistance	100MΩ(500VDC)
Heat rise	80°C
Motor weight	0.21 Kg

CUSTOMER

WIRING CHART

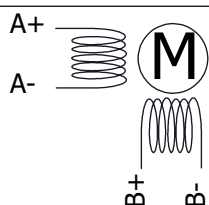

EXCITATION SEQUENCE

CW	—————→			
Red A+	+		-	
Red/wht A-	-		+	
Grn B+		+		-
Grn/wht B-		-		+
CCW	←—————			

NOTICE TO PERSONS RECEIVING THIS DRAWING
THIS DRAWING IS ONLY CONDITIONALLY ISSUED, AND FOR THE SOLE PURPOSE OF INFORMING LICENSEES AND ASSOCIATE CONTRACTORS OF DINGS' MOTION, AND VENDORS THERETO AND CUSTOMERS THEREOF, RECEIPT OR POCESSION THEREOF DOES NOT CONFER TO TRANSFER ANY RIGHT IN THE SUBJECT MATTER OF THE DRAWING. THE DESIGN, CONSTRUCTION, TECHNICAL INFORMATION AND ALL OTHER SUBJECT MATTER SHOWN AND ASSOCIATE CONTRACTORS OF SAID CORPORATION AND ONLY FOR LICENSED MANUFACTURE. AND BY VENDORS MANUFACTURING FOR SAID CORPORATION AND ONLY FOR LICENSEES AND ASSOCIATE CONTRACTORS.

UNLESS OTHERWISE SPECIFIED ALL
DIMENSIONS ARE IN MILLIMETERS AND
TOLERANCES ARE AS BELOW PER ISO2768-cK.

LINEAR		ANGULAR	
0 ~ 3	±0.2	0 ~ 10	±15'
3 ~ 6	±0.5	10 ~ 50	±30'
6 ~ 30	±0.8	50 ~ 120	±1°
30 ~ 120	±1.5	120 ~ 400	±1.5°

DRAWN

APPRVD

MODEL

DATE _____

DATE _____

14E2210BS54

DINGS

SIZE	A3	SHEET	1 OF 1
SCALE	1 : 1	REV	00

